
verítas


Worksurface[™] Risers

The following tools are required to install the risers:

- Phillips screwdriver
- 7/16" socket
- 1. Remove the rubber feet.
- 2. Remove the nuts and washers retaining the track extrusion above where the riser will be located.
- 3. Lift the track extrusion, along with the T-bolts, from the worksurface, then slide the T-bolts out.

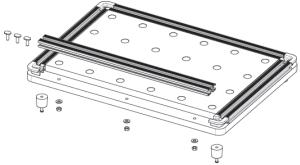

- 4. Slide the long T-bolts provided into the track extrusion.
- 5. Align the long T-bolts with the holes in the worksurface and lower into place.
- 6. Position the riser under the worksurface and insert the long T-bolts into the holes in the riser.

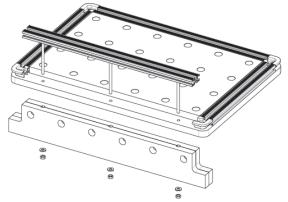

- 7. Reinstall the washers and nuts and tighten.
- 8. Repeat for the other riser.